



# Technical

BMC Australia

A Division of British Leyland Motor Corporation of Australia Pty. Limited

# Bulletin

C1/69

Exp. -

F. O. -

P. S. -

17.2.69

Sighted by


## GEARBOX

Difficulty in pulling up the gearbox to the engine may be due to the case assembly fouling the top left hand of the oil pump cover.

In such cases clearance should be given by removing a small amount of material from the inside of the casing where indicated by an arrow in the sketch.

MG  
MIDGET

MK  
III

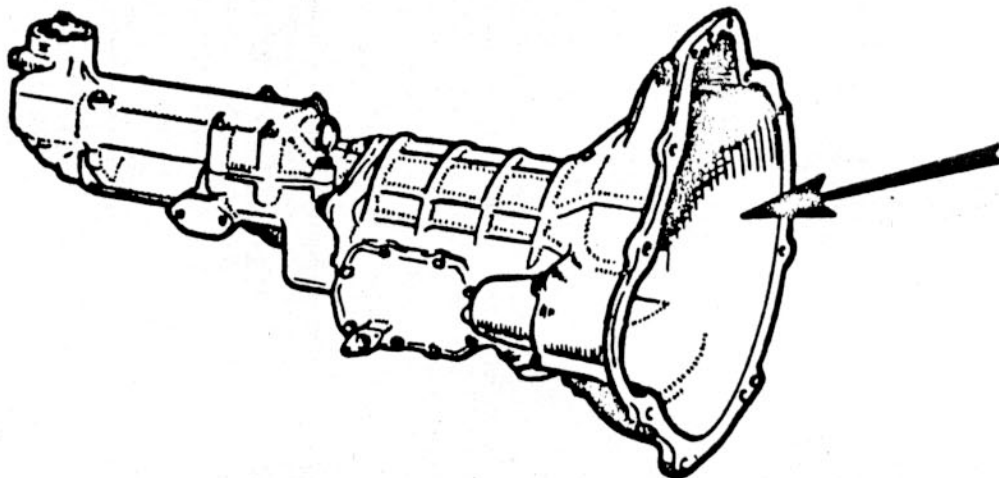

BMC SERVICE DEPARTMENT