



# Service bulletin

C  
231


THE BRITISH MOTOR CORPORATION (AUSTRALIA) PTY. LIMITED

FOR THE ATTENTION OF SERVICE & PARTS MANAGERS.

## CARBURETTOR FLOODING AND FUEL STARVATION

Instances of flooding and fuel starvation have been traced to the new type spring-loaded 'Delrin' float needle and seat assembly, Part No. AUD.9096. The needle body 'A' sticks against the walls of the seat 'B', owing to swelling of the nylon under the influence of certain fuels.

To obviate this trouble the seat bore has been increased from .2445" to .2475"/.2485, groove 'C' having been added to the needle seat to enable the modified assembly to be readily identified.

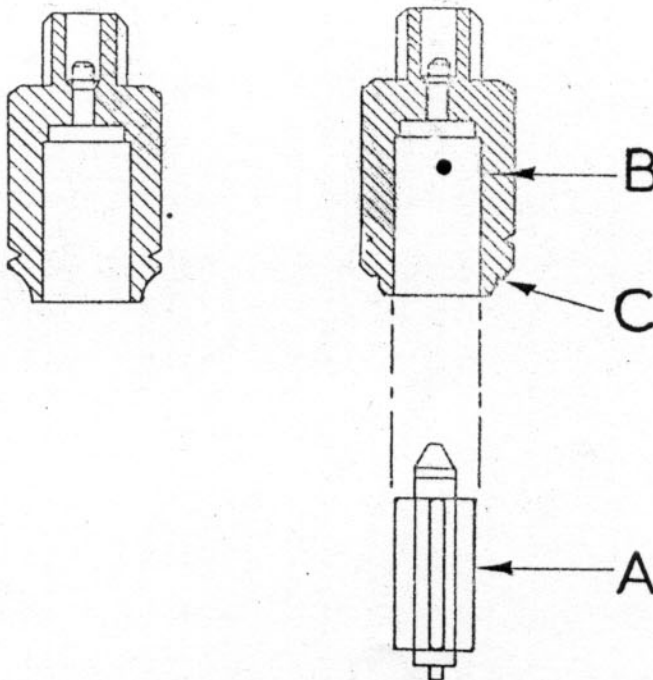

CARS

AUSTIN  
HEALEY  
SPRITE

MK. II &  
MK. IIA

HEALEY 3000  
(BJ.7)

MORRIS  
COOPER

GN/73

10.5.63

Page 1 of

1

*N. Prescott*  
N. Prescott  
Service Manager.