



Service bulletin

THE BRITISH MOTOR CORPORATION (AUSTRALIA) PTY. LIMITED


FOR THE ATTENTION OF SERVICE AND PARTS MANAGERS

GEARBOX MOUNTING

Certain complaints of engine vibration and harshness have been traced to the gearbox rear extension resting on the rear mounting support.

This condition may be rectified by inserting packing pieces, Part No. 2A 5423, between the mounting assembly and the gearbox rear extension, as incorporated in production from the following change-point:

Austin Healey Sprite Mk. III Car No. 48403.

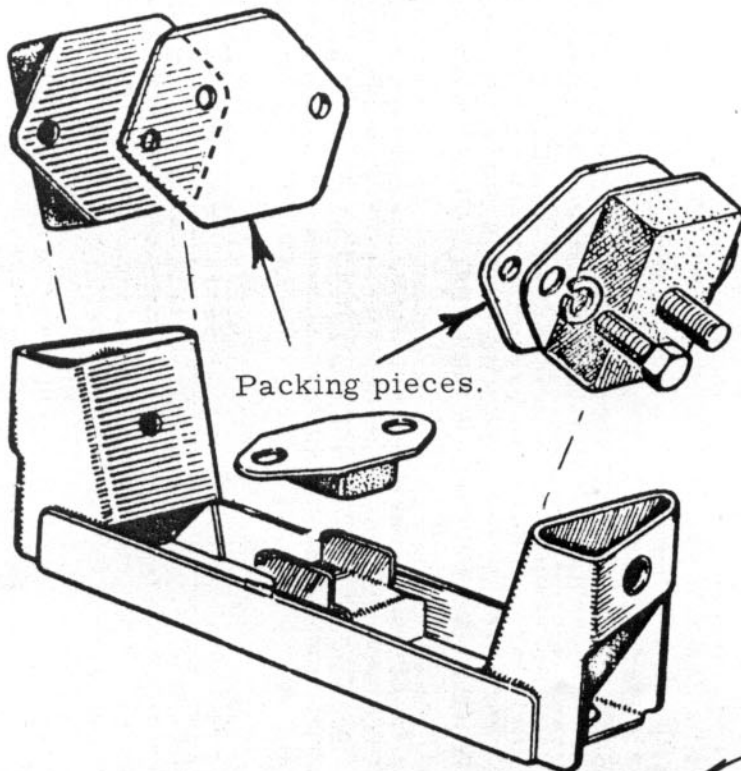

AUSTIN
HEALEY
SPRITE
MK. III

N. Prescott

N. Prescott
Service Manager